



## Firmware for EDS-508A Series Release Notes

<b>Version: v3.9</b>	<b>Build: 21110513</b>
<b>Release Date: Dec 14, 2021</b>	

### Applicable Products

EDS-508A Series

### Supported Operating Systems

N/A

### New Features

N/A

### Enhancements

- Upgraded OpenSSL to 1.0.2k and added support for TLS v1.2.
- Added a memory usage protection function for certain configurations.
- Added an additional encryption option and command to the web UI and CLI.
- Added the “Set” function for standard MIB ifAdminStatus.
- Increased the number of RSTP nodes to 40.

### Bugs Fixed

- When Turbo Ring V2 is working alongside Turbo Chain, and the Head Port link turns on or off, the recovery time increases to < 50 ms.
- Turbo Ring V1 does not work with RSTP Force Edge port.
- The system reboots when reading or writing SNMP OID 1.3.6.1.2.1.2.2.1.1.4294967295.
- Turbo Ring V1 does not work properly.
- Accessing LLDP via Telnet causes the device to reboot.
- SNMP responds slowly when querying the MAC table.
- Disabling the Broadcast Storm Control Port function does not work.
- The ABC-01 does not function properly.
- Some counters show abnormal values after resetting.
- The LLDP configuration webpage is vulnerable to javascript injections.
- Reading speeds are slow when adding a new MAC address.
- IEEE 802.1x authentication may fail under certain conditions.
- The "copy startup-config" CLI command causes the system to restart.
- If Turbo Chain is enabled and the Rate Limit function is configured on the Head Port, the Turbo Chain would become unstable.
- The SFP fiber link behaves abnormally under certain conditions.
- The “get bulk” SNMP command does not work properly for some OIDs.
- TACACS+ authentication would fail under certain conditions.
- OID 1.3.6.1.2.1.17.4.3.1.1 causes the “get” SNMP command to time out.
- The RSTP configuration is missing.
- The Ping function and SNMP do not respond.
- Establishing an SSH connection may cause the system to reboot.
- [MSRV-2017-001][CVE-2019-6518] Plain text storage of a password.
- [MSRV-2017-003][CVE-2019-6526] Missing encryption of sensitive data.
- [MSRV-2017-004][CVE-2019-6524] Improper restriction of excessive authentication attempts.
- [MSRV-2017-005][CVE-2019-6559] Resource exhaustion.
- [MSRV-2017-006][CVE-2019-6557] Buffer overflow in endpoint.
- [MSRV-2017-007][CVE-2019-6522] Device Memory Read.
- [MSRV-2017-009][CVE-2019-6565] Multiple XSS.



- [MSRV-2017-011][CVE-2019-6561] Cross-Site Request Forgery (CSRF).
- [MSRV-2017-013] Use of a broken or risky cryptographic algorithm.
- [MSRV-2017-014] Use of hard-coded cryptographic key.
- [MSRV-2017-015] Use of hard-coded password.
- [MSRV-2017-018] Weak password requirements.
- [MSRV-2017-019] Information exposure.
- [MSRV-2017-020][CVE-2017-13703] Buffer overflow in the session ID.
- [MSRV-2017-021][CVE-2017-13702] Cookie management.
- [MSRV-2017-022][CVE-2017-13700] Cross-site scripting (XSS).
- [MSRV-2017-026] Use of a broken or unsecure cryptographic algorithm.
- [MSRV-2019-002] XSS vulnerability in the LLDP diagnostic page.
- [MSRV-2019-003] Denial of Service (web service) by improper HTTP GET command.
- [MSRV-2019-004] Denial of Service (web service) by over-sized firmware upgrade through HTTP/HTTPS.
- [MSRV-2019-005] Denial of Service (web service) by excessive length of HTTP GET command.

### **Changes**

N/A

### **Notes**

- MSRV is Moxa's internal security vulnerability tracking ID.



<b>Version: v3.8</b>	<b>Build: Build_17041115</b>
<b>Release Date: Apr 05, 2017</b>	

### **Applicable Products**

EDS-508A-MM-SC, EDS-508A-SS-SC-T, EDS-508A-MM-SC-T, EDS-508A, EDS-508A-T, EDS-508A-SS-SC-80-T, EDS-508A-SS-SC, EDS-508A-MM-ST-T, EDS-508A-MM-ST, EDS-508A-SS-SC-80

### **Supported Operating Systems**

N/A

### **New Features**

N/A

### **Enhancements**

- Add warning message when default password was not changed
- Encrypt security Keys in user interface
- Enhance RSTP compatibility

### **Bugs Fixed**

- Cross-site scripting vulnerability.
- Denial of Service attack vulnerability.
- Privilege escalation vulnerability.
- SSL v2/v3 vulnerability in https.
- Web console cannot be accessed due to SNMP get bulk.
- Specific CLI command cause switch reboot with default settings.
- Add a new VLAN will change IGMP querier state from disable to enable.
- Saving configuration to ABC-01 cannot be performed via IE browser.
- Rate limit cannot be set in web UI.
- Telnet hangs after SSH disabled.
- Correct RSTP edge definition in exported configuration file.
- Correct authorization of Radius/TACACS+ login.
- Correct RSTP Auto-Edge behavior.
- After upgrade firmware, the system maybe warm start when the user login the switch.

### **Changes**

N/A

### **Notes**

N/A



<b>Version: v3.4</b>	<b>Build: Build_14121010</b>
<b>Release Date: N/A</b>	

**Applicable Products**

EDS-508A

**Supported Operating Systems**

N/A

**New Features**

N/A

**Enhancements**

N/A

**Bugs Fixed**

- Web user interface display errors under Java 8 environment

**Changes**

N/A

**Notes**

N/A



<b>Version: v3.3</b>	<b>Build: N/A</b>
<b>Release Date: N/A</b>	

### **Applicable Products**

EDS-508A

### **Supported Operating Systems**

N/A

### **New Features**

N/A

### **Enhancements**

- Added web interface for loop-protection enable/disable.
- Added web interface for SSH/SSL key generation.
- Added web interface/CLI/SNMP for NTP/SNTP client settings.

### **Bugs Fixed**

- Login failed in CLI mode when password included special characters.
- Hybrid VLAN lacked SNMP MIB object.
- IEEE 1588 PTP could not function correctly.
- Importing configurations was restricted if the system name was too long.
- Login authentication failed if the radius server did not support privilege levels assignment.
- DIP switch “Coupler” On/Off malfunctioned.

### **Changes**

N/A

### **Notes**

N/A



<b>Version: v3.1</b>	<b>Build: N/A</b>
<b>Release Date: N/A</b>	

### **Applicable Products**

EDS-508A

### **Supported Operating Systems**

N/A

### **New Features**

N/A

### **Enhancements**

- Passed ODVA EtherNet/IP certificate.
- Added some minor SNMP OIDs.
- Enhanced multicast performance.
- Added version number in MIB file.

### **Bugs Fixed**

- NTP could not synchronize time in the default settings.
- NTP client function did not work with Windows XP NTP server.
- Firmware upgrade failed when IEEE 802.1x was enabled.
- Switch rebooted when receiving IGMP v3 packets (commonly used in Windows 7).

### **Changes**

N/A

### **Notes**

N/A



<b>Version: v3.0</b>	<b>Build: N/A</b>
<b>Release Date: N/A</b>	

### **Applicable Products**

EDS-508A

### **Supported Operating Systems**

N/A

### **New Features**

- RSTP-2004
- MSTP
- NTP Server/Client
- IEEE 1588 PTP V2
- RADIUS and TACACS+ for user login authentication
- RADIUS for 802.1x port authentication
- Hybrid VLAN
- Command Line Interface
- EtherNet/IP
- Egress rate limit
- Unknown unicast filtering
- CPU loading monitoring
- Change IP without reboot
- DHCP Discover retry configuration
- GARP timer adjustment
- Loop-protection
- Link Fault Shutdown (Disable mode in “Rate Limit” function)

### **Enhancements**

N/A

### **Bugs Fixed**

N/A

### **Changes**

N/A

### **Notes**

N/A



<b>Version: v2.6</b>	<b>Build: N/A</b>
<b>Release Date: Apr 02, 2010</b>	

### **Applicable Products**

EDS-508A-MM-ST, EDS-508A-T, EDS-508A-SS-SC-T, EDS-508A-SS-SC-80-T, EDS-508A-MM-SC, EDS-508A-SS-SC-80, EDS-508A-SS-SC, EDS-508A-MM-SC-T, EDS-508A-MM-ST-T, EDS-508A

### **Supported Operating Systems**

N/A

### **New Features**

N/A

### **Enhancements**

- Enhance Turbo Chain function

### **Bugs Fixed**

N/A

### **Changes**

N/A

### **Notes**

For products with firmware prior to v2.6, users must upgrade to v2.6 before upgrading to the latest v3.X firmware.





<b>Version: v2.5</b>	<b>Build: N/A</b>
<b>Release Date: N/A</b>	

**Applicable Products**

EDS-508A

**Supported Operating Systems**

N/A

**New Features**

- Supports TurboPack™ 2009 (added new functions for Turbo Chain, IPv6, Modbus/TCP, IEEE 1588 PTP, SNMP Inform, LLDP, DHCP Option 82, Firefox, and SSH)

**Enhancements**

N/A

**Bugs Fixed**

N/A

**Changes**

N/A

**Notes**

N/A



<b>Version: v2.1</b>	<b>Build: N/A</b>
<b>Release Date: N/A</b>	

### **Applicable Products**

EDS-508A

### **Supported Operating Systems**

N/A

### **New Features**

- Added new Turbo Ring (“Turbo Ring V2”) function
- Added new Ring Coupling function
- Added Daylight Saving function

### **Enhancements**

N/A

### **Bugs Fixed**

N/A

### **Changes**

N/A

### **Notes**

N/A



<b>Version: v1.3</b>	<b>Build: N/A</b>
<b>Release Date: N/A</b>	

**Applicable Products**

EDS-508A

**Supported Operating Systems**

N/A

**New Features**

- Syslog function
- Restart function

**Enhancements**

N/A

**Bugs Fixed**

N/A

**Changes**

N/A

**Notes**

N/A



<b>Version: v1.2</b>	<b>Build: N/A</b>
<b>Release Date: N/A</b>	

**Applicable Products**

EDS-508A

**Supported Operating Systems**

N/A

**New Features**

- New firmware release for the EDS-508A Series

**Enhancements**

N/A

**Bugs Fixed**

N/A

**Changes**

N/A

**Notes**

N/A