

# Firmware for NPort 5600-DT Series Release Notes

Version: v2.6 Build: Build: Build 19032122

Release Date: Mar 29, 2019

# Applicable Products

NPort 5600-DT Series

## **Supported Operating Systems**

N/A

#### **New Features**

- Supports HTTPS.
- Supports MXview auto-topology function.
- Supports MXconfig.
- Supports SNMPv2c.
- Supports IGMP.
- Supports new flash because of component end-of-life.

#### **Enhancements**

- Accessible IP list can now be used to restrict all device services.
- Complies with Moxa Security Guidelines on the following: Account Authentication Management, Network Service Management, and Audit and Log Management.
- CVE-2017-14028: An attacker may be able to exhaust memory resources by sending a large amount of TCP SYN packets.
- CVE-2017-16715: An attacker may be able to exploit a flaw in the handling of Ethernet frame padding that may allow for information exposure.
- CVE-2017-16719: An attacker may be able to inject packets that could potentially disrupt the availability of the device.
- Updates the web UI.

# **Bugs Fixed**

- NPort does not send SNMP Authentication Failure trap.
- Pair connection mode cannot resolve the domain name.

#### Changes

N/A

#### **Notes**



Version: v2.5 Build: Build: Build 17030709

Release Date: Mar 14, 2017

## **Applicable Products**

NPort 5610-8-DT, NPort 5610-8-DT-J, NPort 5650-8-DT, NPort 5650I-8-DT, NPort 5650-8-DT-J

# **Supported Operating Systems**

N/A

### **New Features**

N/A

### **Enhancements**

N/A

### **Bugs Fixed**

• The user's password and SNMP community name may be exposed by a buffer overflow issue.

# **Changes**

N/A

## **Notes**



Version: v2.4 Build: Build: Build 16100514

Release Date: N/A

## **Applicable Products**

NPort 5610-8-DT, NPort 5610-8-DT-J, NPort 5650-8-DT, NPort 5650I-8-DT, NPort 5650-8-DT-J

### **Supported Operating Systems**

N/A

#### **New Features**

N/A

### **Enhancements**

- Enhanced web login security and supports 5 users logged in simultaneously.
- Extended HTTP challenge ID length from 32 bits to 256 bits.
- Enabled the default password "moxa".
- Increased CSRF protection mechanism.
- Increased XSS protection mechanism.
- The IP address of the NPort can be set to an address ending with 0 or 255.
- Supports "ARP probe" in RFC5227. NPort would respond for ARP requests with sender IP address 0.0.0.0.

## **Bugs Fixed**

- NPort cannot send e-mail using Google's SMTP server.
- In pair connection mode, master does not pull down RTS/DTR signal after the TCP connection is broken.
- Command port sends lots of "D\_ASPP\_CMD\_ALIVE" packets after running for 50 days.
- NPort may reboot or hang from several buffer overflow attacks through Telnet, SSH, DSCI, SNMP, HTTP, and HTTPS.

### **Changes**

N/A

### **Notes**



Version: v2.3 Build: Build: Build 15041515

Release Date: N/A

### **Applicable Products**

NPort 5610-8-DT, NPort 5610-8-DT-J, NPort 5650-8-DT, NPort 5650I-8-DT, NPort 5650-8-DT-J

### **Supported Operating Systems**

N/A

### **New Features**

N/A

### **Enhancements**

- Uses model name instead of "NULL" for SNMP object "sysDescr".
- Supports connecting to the server by domain name and the server IP will change dynamically.
- Supports updating the ARP table by gratuitous ARP.
- Supports time synchronization with an NTPv4 server.
- Supports RFC2217 NOTIFY-LINESTATE for Transfer Shift Register Empty and Transfer Holding Register Empty.

# **Bugs Fixed**

- If an SNMP GETNEXT command is issued on an object that does not exist, 'no such name error' is displayed.
- When DHCP renews IPs, if the IP was originally given by a relay agent, NPort should send a DHCP request to the relay agent, not the DHCP server.
- In Real COM mode, when the modem status of the NPort's serial port is changed frequently, the NPort will sometimes fail to notify the change to the driver.
- In reverse telnet mode, the NPort will try to subnegotiate the COM port control options without option negotiation first.
- In RFC2217 Mode, if the Ethernet data has many FF characters, some data may be lost while passing the data to the serial side.
- The telnet console and serial console sometimes do not work.

#### **Changes**

N/A

#### **Notes**